



GREENWORKS SERVICE COMPANY

855-349-6757

support@greenworksinspections.com

<https://greenworksinspections.com>



GW STANDARD HOME INSPECTION



Inspector

Brian Baney

TREC #25877, TBPE FIRM #20170, MOLD FIRM #ACO1162, TPCL FIRM #0761253

815-988-3542

brian.baney@greenworksinspections.com



Agent



PROPERTY INSPECTION REPORT FORM

<i>Name of Client</i>	08/23/2023 9:30 am
<i>Date of Inspection</i>	
<i>Address of Inspected Property</i>	
Brian Baney	TREC #25877, TBPE FIRM #20170, MOLD
<i>Name of Inspector</i>	FIRM #ACQ1462, TPCL FIRM #0761253
<i>Name of Sponsor (if applicable)</i>	<i>TREC License #</i>

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILITY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified and licensed (if applicable) service professionals. Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathroom, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as, smoke alarms, fire-rated doors in certain locations,

and functional emergency escape and rescue openings in bedrooms;
malfunctioning carbon monoxide alarms;
excessive spacing between balusters on stairways and porches;
improperly installed appliances;
improperly installed or defective safety devices;
lack of electrical bonding and grounding; and
lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms requires a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Note to clients: Upon downloading or printing this report from e-mail, some users have found that some of the checkmarks in the boxes are not marked; this is due to the fact that their computers may not have the correct fonts installed. Should your report lack these checkmarks or have any other flaws please contact us immediately for a faxed copy. GreenWorks recommends that only professionally licensed contractors complete any repairs listed, prior to closing. The inspection does not include any destructive testing or dismantling. It is possible that in the process of repair, items may be discovered that were not apparent to the inspector at the original time of inspection. Inspectors cannot be held liable for such hidden defects by the client(s). This report is prepared exclusively for the above named Client(s). It cannot be transferred to or used by any other parties in any form. Client(s) gives permission for the Inspector to discuss report findings with real estate agents, lenders, specialists, or repair persons for the sake of clarification. Additional pages may be attached to this report. Read them very carefully. This report may not be complete without the attachments. Comments may be provided by the inspector whether or not an item is deemed in need of repair. Additional information may be obtained at our website: www.GreenWorksInspections.com

NOTE: Pictures are a representative sample, and do not display every defect.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

I NI NP D

TITLE PAGES

Additional Info Provided By Inspector

Inspection Scope: Full (All Utilities Were Turned On)

Occupancy: Vacant (Stored items present - viewing restricted)

Structure Type: House

Parties Present: Buyer

Additional Documents Provided: N/A

Weather Conditions: Sunny

Additional Written Information Provided: Yes

Remodeled?: No

New Const?: Yes

Additions?: No

Property Faces: Southwest

Arrival Temperature (Approximate): 90's

Departure Temperature (Approximate): 100 or Higher

I	NI	NP	D
---	----	----	---

I. STRUCTURAL SYSTEMS

A. Foundation

Comments:

Foundation Type: Slab

Foundation Visibility: Partly Visible

Foundation Performance Opinion:

Performing - At this time, the foundation appears to be supporting the structure and immediate significant repair needs are not evident. Seasonal expansion and contraction observed which is considered normal for age, location and soil conditions. No major movement noted at the time of inspection.

Additional Comments:

Some trees may remove a few hundred gallons of water in a single day through transpiration and if they are allowed to grow too close to the structure could cause foundation problems.

Soil movement, settlement, or upheaval is directly transmitted to the foundation. It is not unusual to see a foundation in this region move in response to moisture various that normally attend seasonal changes.

Settlement of a foundation that is seasonal related usually occurs during the hot and dry summer months when the soil can sometimes dry out to a depth of more than ten feet. This drying or desiccation occurs from soil surface evaporation and transpiration of water from vegetation. Large bushes such as Red Tip Photinias and River-bottom trees consume a lot of water and should not be planted near a foundation. Heaving of a foundation that is seasonally related usually occurs during the colder and wetter months. Usually the winter months are wetter, so soils in our area tend to swell and raise the foundation. Differential foundation movement is normally the result of variations in the moisture content of the soil such as: non-uniform watering of vegetation, poor drainage way from the foundation, or leaking plumbing lines. It is possible that portions of a foundation that have previously not moved can move sometime in the future. It should be noted that clay type soils have higher bearing capacity but are subject to more movement, while sandy type soils have lower bearing capacity but are subject to less movement.

The inspector is not a professional engineer and is giving an opinion as mandatory. If you have any concerns about the foundation life expectancy, insurability, or the potential for future problems, a professional engineer should be consulted.

Crawlspace Viewed From : N/A

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) enter a crawl space or any area where headroom is less than 18 inches or the access opening is less than 24 inches wide and 18 inches high;

(B) provide an exhaustive list of indicators of possible adverse performance; or

(C) inspect retaining walls not related to foundation performance.

The foundation performance opinion stated below neither in any way addresses future foundation movement or settlement, nor does it certify floors to be level. Soil in the Central Texas area is known to be unstable and unpredictable. Should you have present or future concerns regarding the foundation's condition, you are strongly advised to consult with your builder and/or a licensed Professional Structural Engineer for further evaluation

Heavy Foliage:

The heavy foliage around the structure should be trimmed and lowered to allow observation for insect activity. This condition is also conducive to moisture issues.

High Soil:

The high soil around the structure should be trimmed and lowered to allow observation for insect activity. This condition is also conducive to moisture issues.

Bushes/Shrubs:

There were bushes and shrubs blocking visibility of the foundation wall in areas.

I	NI	NP	D
---	----	----	---

Townhome Foundation:

Townhome type home. Foundation is shared between owners and is not the sole responsibility of the individual owner. Only the foundation at inspected address was observed.

1: Missing Corner Pop

🔴 Recommendation

The foundation corner pop is missing at the corner of the home.

Recommendation: Contact a qualified concrete contractor.



2: Honeycombing

🔧 Handyman/Maintenance Item

Honeycombing was present at the foundation wall. These areas should be monitored.

Recommendation: Recommend monitoring.



3: Foundation Previous Repair

🔧 Handyman/Maintenance Item

I	NI	NP	D
---	----	----	---

There was evidence of previous repairs around the perimeter of the home. Inspector cannot confirm the extent or accuracy of the repairs. A Professional Engineer should be consulted if additional information is needed.



Garage

B. Grading/Drainage

Comments:

Gutters Present: Yes (Guttering Not Tested.)

Positive Slope on All Sides of Home: Yes

Evidence of Water Penetration: No

Area Drains Present: Yes (Drains Not Tested and Termination Points are Not Determined)

Additional Information:

The strategy of a foundation is important. Expansive clay soils, which are found in this part of Texas, can be very destructive to a foundation if the moisture content of the perimeter varies. The industry standard is a grading slope of six inches within the first ten feet of a foundation. Excessive moisture forming near a structure can be destructive to a foundation. If adding soil to the perimeter to create positive drainage, remember to keep the soil level at least 4 inches from the top of the foundation. If you are able to verify that the structure is built on a clay type soil (as determined by a soil analysis testing) then that type of soil should be used to raise the soil level. Porous soils should be avoided.

Ideally finished grade, including flower bed soil, should be 4" from the top of the foundation to help prevent conducive conditions for water penetration and/or wood destroying insects.

It is recommended that all areas where expansive or collapsible soils are known to exist, a controlled method of water disposal from the roofs that will collect and discharge all roof drainage to the ground surface at least 5' from the foundation or to an approved drainage system.

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) inspect flatwork or detention/retention ponds (except as related to slope and drainage);

(B) determine area hydrology or the presence of underground water; or

(C) determine the efficiency or performance of underground or surface drainage systems.

During heavy rains, the accumulation of water on this lot may be unavoidable. An evaluation of soil stability is beyond the scope of this inspection. Client is advised to keep soil levels 6"-8" from top of slab and graded away to promote positive drainage and prevent water from ponding around the foundation. High soil is a conducive condition to wood destroying insects.

Condominium/Townhome Grading:

I NI NP D


Condominium/Townhome type home. Grading is shared between owners and is not the sole responsibility of the individual owner. Only the grading at inspected address was observed.

1: Over/Under-Exposure

Recommendation

There were areas of excessive/Insufficient exposure of the foundation wall. Preferably 6 to 8 inches of foundation exposure should be present around the perimeter of the home. The higher the soil level the more inviting it is for wood destroying insect activity and moisture intrusion.

Recommendation: Contact a qualified grading contractor.

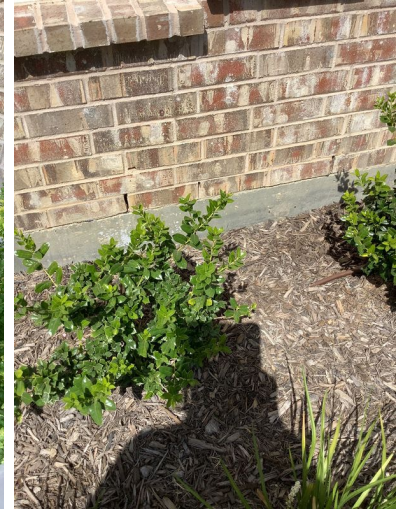

C. Roof Covering

Comments:

General Roof Photos:



I NI NP D



Roof Viewed From: Roof, Ladder, Ground, Binoculars

Weather Conditions: Sunny

Roof Covering Materials: Asphalt composition

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

- (A) determine the remaining life expectancy of the roof covering;
- (B) inspect the roof from the roof level if, in the inspector's reasonable judgment, the inspector cannot safely reach or stay on the roof or significant damage to the roof covering materials may result from walking on the roof;
- (C) determine the number of layers of roof covering material;
- (D) identify latent hail damage;
- (E) exhaustively examine all fasteners and adhesion, or
- (F) provide an exhaustive list of locations of deficiencies and water penetrations.

Roof materials have a limited service life and may require spot repairs should leaks develop prior to replacement. Roof maintenance is an ongoing process and includes keeping the roof free of tree debris, replacing any loose, damaged, or missing shingles, and sealing any gaps at flashing materials. This report neither addresses future roof leaks nor does it certify the roof to be leak-free. A roofing specialist should be consulted about any concerns over roof covering life expectancy or the potential for future problems. Please note: Homeowners insurance companies use different standards and criteria for determining whether they will issue an insurance policy. These standards differ from each insurance company, as each has their own standards. Please be advised that this report does not certify nor guarantee that an insurance company will accept or reject an insurance policy based on the condition of this roof. This roof is not inspected for Insurability or Life Expectancy, and is inspected for function ONLY. As the purchaser, you may wish to have your insurance carrier inspect for insurance coverage.

Roof Flashing Not Visible:

Flashing was not fully visible in all areas. Proper flashing could not be fully confirmed due to being covered.

General Roof:

The roofing inspection is a visual attempt to find major defects present at the time of inspection. If you have any concerns about the roof covering life expectancy, insurability or the potential for future problems, a roofing specialist should be consulted.

Condominium/Townhome Roof:

Condominium or Townhome roof covering is shared between owners and is not the sole responsibility of the individual owner. Only the roof covering at inspected address was observed.

I	NI	NP	D
---	----	----	---

D. Roof Structure and Attic

Comments:

General Attic Photos:



I	NI	NP	D
---	----	----	---



Roof Decking Type: Radiant Barrier Board, Plywood

Framing Type: Conventional

Ventilation Type: Soffit, Passive Vent

Attic Entry Point: Interior

Attic Inspected: Yes - Walked decked Safe Areas Only

Insulation Type: Fiberglass

Insulation Amount: 12 - 18 inches - Attic Floor

Attic Temperature (Approximate °F): 61-70

Attic Humidity (Approximate %): 51-60

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) enter attics or unfinished spaces where openings are less than 22 inches by 30 inches or headroom is less than 30 inches;

(B) operate powered ventilators; or

(C) provide an exhaustive list of locations of deficiencies and water penetrations.

The inspector cannot enter an attic with less than 5' (feet) of vertical clearance, or where he reasonably determines that conditions or materials may be unsafe. Insulation covering structural, mechanical, or electrical components may preclude inspection of these items. The inspector will report his/her attic inspection point.

Insulation improvements may be cost effective depending on the anticipated term of ownership. For your information the Department of Energy currently recommends an insulation value of R-30 to R-60 for the attic area. The R-Value is determined by the depth of the insulation, type of insulation used (bats, rolls, loose-fill, etc.) and the material the insulation is made of (fiberglass, rock wool, cellulose, etc.)

Attic:

Attic Space is Limited. Viewed from Accessible Areas Only. Insulation is not lifted, moved, or disturbed to observe for hidden defects or concerns.

Attic - Safe Walkboards Only:

Attic observed from safe walk boards only. Entered attic and performed an incomplete limited visual inspection due to obstructions and inaccessible areas.

Radiant Barrier - Foil:

Radiant barrier foil covers the attic decking. The decking could not be fully inspected due to this installation.

1: High Humidity Attic

I NI NP D

🔴 Recommendation

Relative humidity levels were higher than 60% in the attic area. Humidity levels over 60% is a conducive condition for biological growth. The reading taken at the time of inspection is only a representative reading and may not reflect the humidity readings at other times or under other conditions. It is only to be used to determine if there is a potential issue in this area. The only way to properly determine the humidity level is to take multiple readings over multiple days in various weather conditions.


Recommendation: Contact a qualified professional.

2: Low insulation

🔴 Recommendation

There were areas of low insulation. The Department of Energy currently recommends an insulation value of R-30 to R-49 for the attic area.

Recommendation: Contact a qualified insulation contractor.

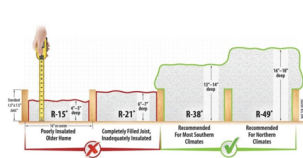

3: Light From Exterior Visible From Attic

🔴 Recommendation

Light from the exterior was visible from within the attic. These should be sealed to prevent water or pest entry.

Recommendation: Contact a qualified professional.

I NI NP D



4: Attic Door Gapped

🔴 Recommendation

Attic cover door is gapped when shut. The attic access door should be sealed when shut to prevent energy loss.

Recommendation: Contact a qualified professional.



E. Walls (Interior and Exterior)
Comments:

Exterior
Front Exterior Photos:

I	NI	NP	D
---	----	----	---



Rear Exterior Photos:



Left Exterior Photos:



Right Exterior Photos:

I NI NP D



Exterior Wall Cladding Type: Brick, Hardie Plank

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) report cosmetic damage or the condition of floor, wall, or ceiling coverings; paints, stains, or other surface coatings; cabinets; or countertops,

(B) provide an exhaustive list of locations of deficiencies and water penetrations, (C) report the condition of awnings, blinds, shutters, security devices, or other non-structural systems; or

(D) determine the cosmetic condition of paints, stains, or other surface coatings.

The inspector cannot determine the condition of wood or structural components hidden within wall cavities.

No opinion as to the condition of the wood, structural members, vapor barriers, insulation, or other components in hidden areas is implied or intended by this report.

Townhome - Exterior wall:

Townhome type home. Exterior wall is shared between owners and is not the sole responsibility of the individual owner. Only the exterior wall at the inspected address was observed.

1: Brick Cracks

🔴 Recommendation

There were brick cracks noted at the time of inspection.

Recommendation: Contact a qualified professional.

I NI NP D



2: Mortar Separation

🔴 Recommendation

Areas of mortar and/or joint separation were observed at the exterior walls.

Recommendation: Contact a qualified masonry professional.



I	NI	NP	D
---	----	----	---



3: Lack of Sealed Penetrations

🔴 Recommendation

It is recommended that all protrusions through the siding and fixtures mounted on the exterior be sealed in order to prevent moisture incursion. Using a quality exterior caulk type sealant around pipes, wires, light fixtures etc. can prevent moisture related failure of electrical components and siding materials.

Recommendation: Contact a qualified professional.



4: Separation - Exterior Trim

🔴 Recommendation

Areas of trim were separating and lacked proper caulking. These areas are conducive for water penetration into the home.

I	NI	NP	D
---	----	----	---



5: Spalling

🔴 Recommendation

Spalling was observed at the exterior veneer. Various areas of cracking and damage were observed. Veneer materials were flaking, and missing portions of material.

Recommendation: Contact a qualified masonry professional.



Back

6: Caulking - Exterior wall joints

🔴 Recommendation

There was separated caulking at the exterior wall joints. All wall joints should water tight and sealed. Repair is recommended.

I NI NP D



7: Frieze Board Separation

🔴 Recommendation

There was an area of frieze board separation.

8: Lintel Needs Paint

🔴 Recommendation

Some of the brick lintels need to be painted.

Recommendation: Contact a qualified painting contractor.




9: Frieze/Wall Gap

🔴 Recommendation

There are openings at some of the wall and frieze board junction points. Openings are large enough for pests to enter.

Recommendation: Contact a qualified professional.

I	NI	NP	D
---	----	----	---

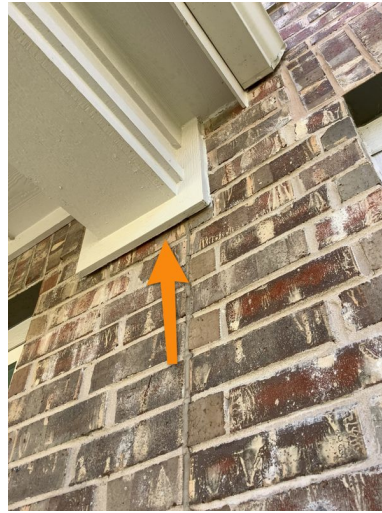

Interior



Interior Photos:





I NI NP D



I NI NP D

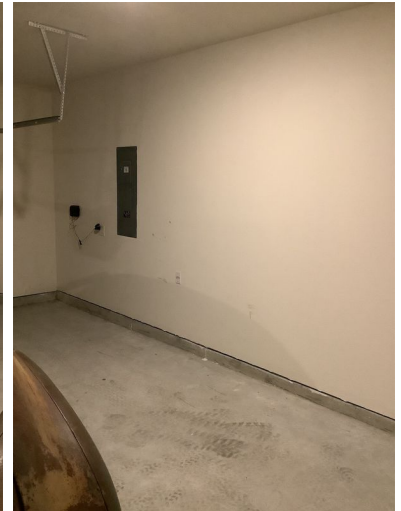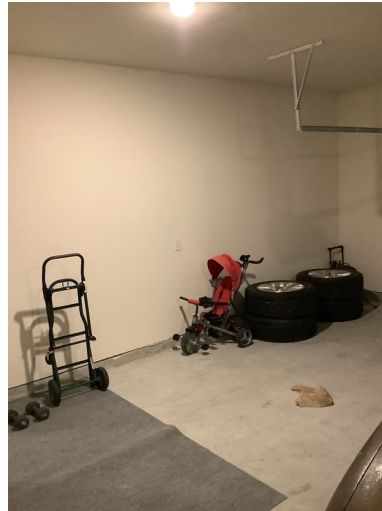

I NI NP D

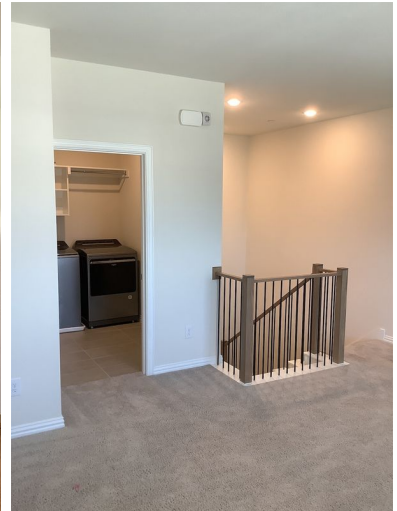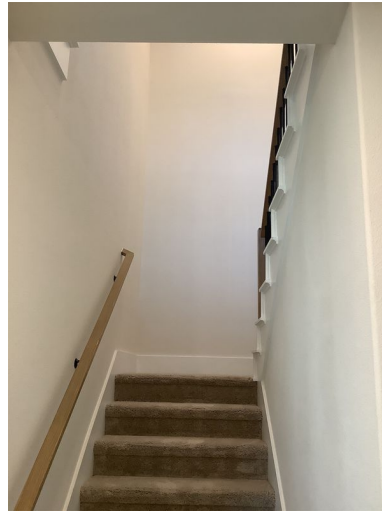



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient


I NI NP D

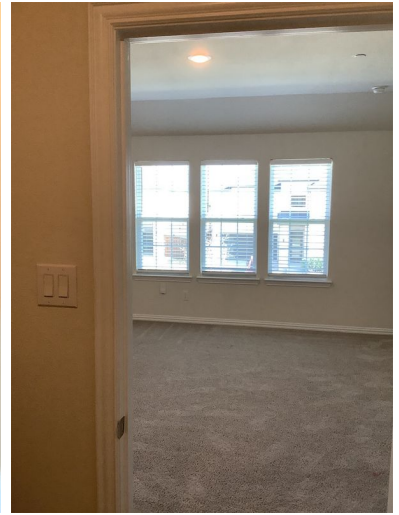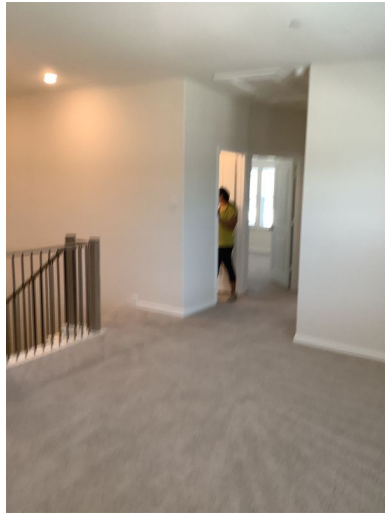

I NI NP D



I	NI	NP	D
---	----	----	---

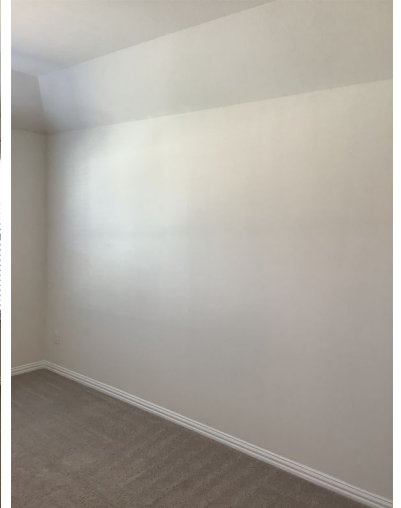

*Interior Wall Finishes: Sheet Rock
Interior Infrared Photos:*


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

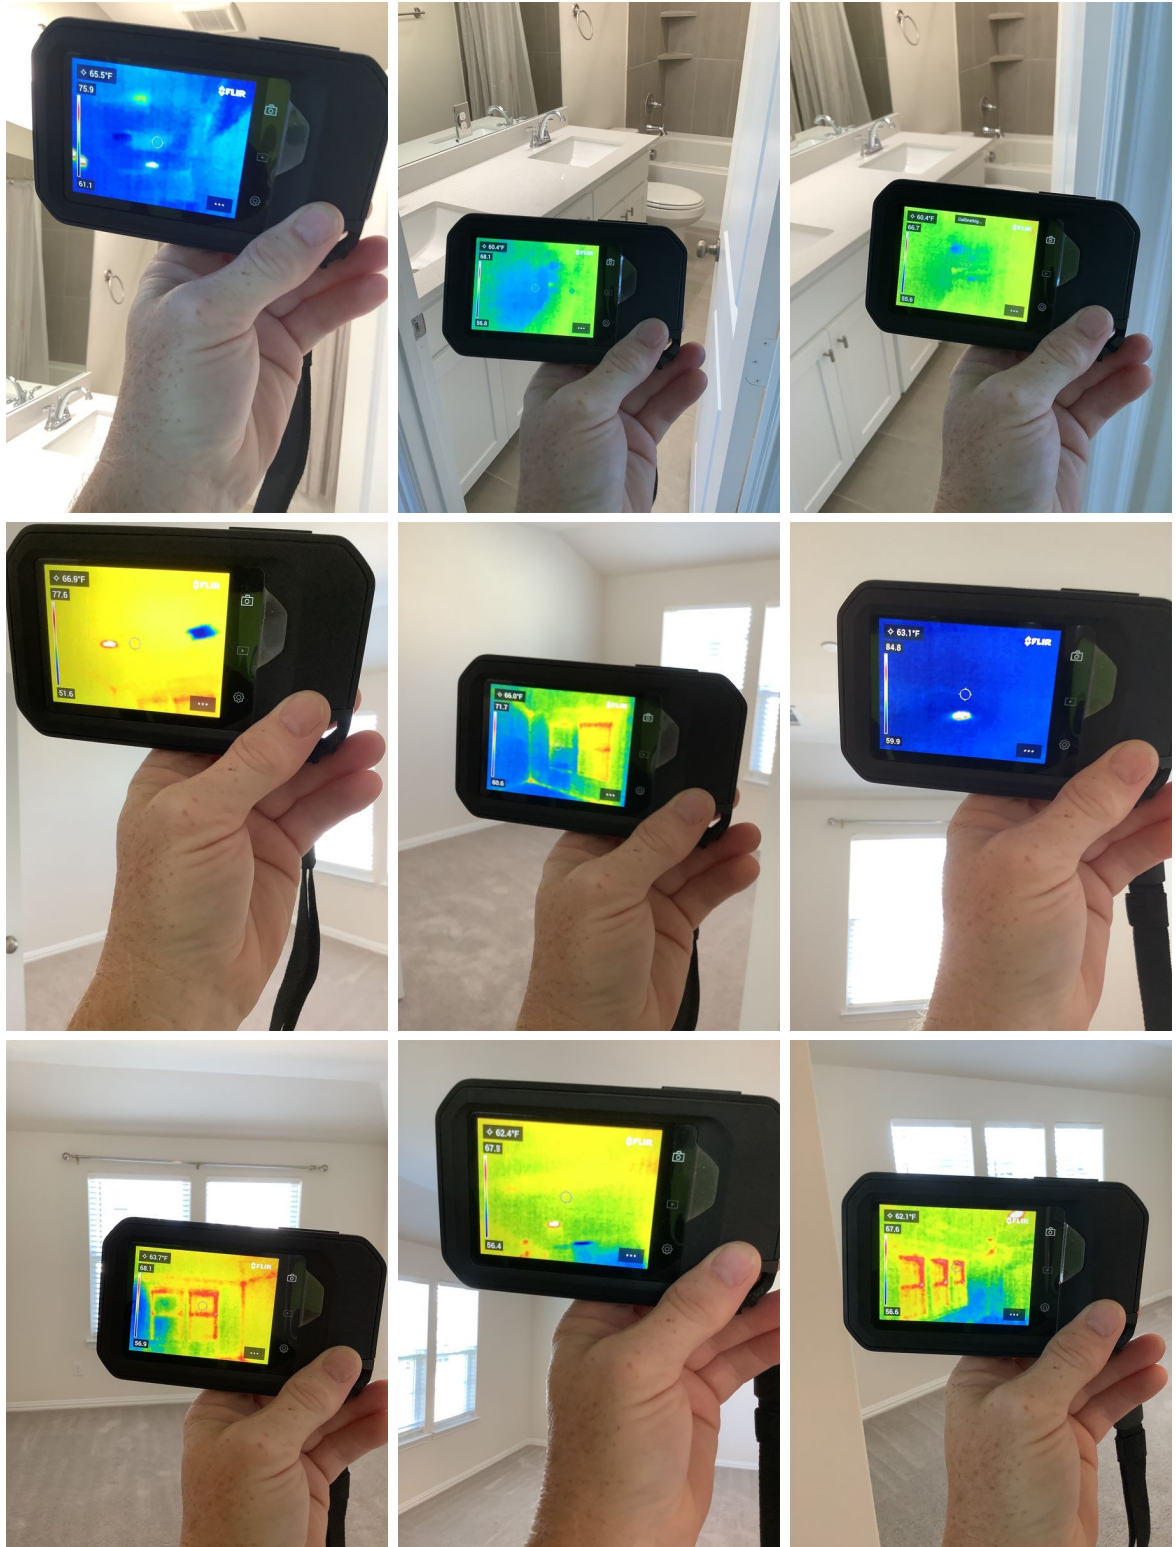

I NI NP D



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



I NI NP D



Interior Walls Painted:

Some of the walls appear to have been recently painted. This may hide some stains, mildew, or other damage that may exist.

Interior Walls Covered:

The home was occupied or staged. There were mirrors, paintings or other coverings present at some walls within the home. These coverings may hide stains, mold or other damage that could be present.

1: Interior Wall Cracks

🔴 Recommendation

Interior wall cracks were observed at the time of inspection.

Recommendation: Contact a qualified drywall contractor.



Master/Primary

2: Caulking Counter Connection

🔧 Handyman/Maintenance Item

Caulking is needed at the wall / counter connection point.

I	NI	NP	D
---	----	----	---



Bathroom

3: Nicks/Missing Paint

[🔧 Handyman/Maintenance Item](#)

There are nicks and missing paint in various areas.

Recommendation: Contact a qualified painting contractor.

4: Joint Separation

[🔧 Handyman/Maintenance Item](#)

There are joint separations in various areas.

Recommendation: Contact a qualified drywall contractor.



Bathroom



Garage

5: Trim Separation/Gapping

[🔧 Handyman/Maintenance Item](#)

Trim separation was observed at areas of the interior trim materials.

I NI NP D

Recommendation: Contact a qualified professional.



F. Ceilings and Floors

Comments:

Ceilings

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) report cosmetic damage or the condition of floor, wall, or ceiling coverings; paints, stains, or other surface coatings; cabinets; or countertops,

(B) provide an exhaustive list of locations of deficiencies and water penetrations; or

(C) determine the cosmetic condition of paints, stains, or other surface coatings.

The inspector cannot determine the condition of structural components in hidden ceiling or floor cavities. No opinion as to the condition of the wood, structural members, or other components in hidden areas is implied or intended by this report.

Floors

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) report cosmetic damage or the condition of floor, wall, or ceiling coverings; paints, stains, or other surface coatings; cabinets; or countertops,

(B) provide an exhaustive list of locations of deficiencies and water penetrations; or

(C) determine the cosmetic condition of paints, stains, or other surface coatings.

The inspector cannot determine the condition of structural components in hidden ceiling or floor cavities. No opinion as to the condition of the wood, structural members, or other components in hidden areas is implied or intended by this report.

1: Garage Floor Cracks

[Handyman/Maintenance Item](#)

There were cracks in the garage floor. This is typical of concrete and is not considered significant. It should be monitored for large separations or differential movement.

Recommendation: Contact a qualified professional.

I NI NP D



2: Carpet Stains

🔴 Recommendation

Upstairs

Carpet had areas of staining or discoloration. Recommend a thorough steam clean by a qualified carpet cleaning company

Recommendation: Contact a qualified cleaning service.



G. Doors (Interior and Exterior)

Comments:

Entry Door Type: Wood/Fiberglass

Overhead Garage Door Type: Fiberglass

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) report the condition of awnings, blinds, shutters, security devices, or other non-structural systems;

(B) determine the cosmetic condition of paints, stains, or other surface coatings; or; (C) operate a lock if the key is not available,

I	NI	NP	D
---	----	----	---

(D) provide an exhaustive list of locations of deficiencies and water penetrations. The inspector cannot determine the condition of wood or structural components hidden within wall cavities. No opinion as to the condition of the wood, structural members, vapor barriers, insulation, or other components in hidden areas is implied or intended by this report. We do NOT inspect for Safety Glass or Storm Doors.

1: Shower Door Collides

[🔧 Handyman/Maintenance Item](#)

The shower door collides with another surface in the bathroom. Risk for damage is high and adjustment or stopper installation is recommended.

Recommendation: Contact a handyman or DIY project



Master/Primary

2: Loose Door Knobs

[🔧 Handyman/Maintenance Item](#)

There were loose doorknobs in areas of the home.



Garage

I	NI	NP	D
---	----	----	---

3: Overhead Garage Door - Denting and damage

🔴Recommendation

There is denting and damage to the overhead garage door.

Recommendation: Contact a qualified door repair/installation contractor.



4: Damaged Weather Stripping

🔴Recommendation

The door has a damaged weather strip. This can result in significant energy loss and moisture intrusion. Recommend installation of standard weatherstripping.

[Here is a DIY guide on weatherstripping.](#)

Recommendation: Contact a qualified door repair/installation contractor.



5: Exterior Doors - Air and Light

🔴Recommendation

Entryway, Garage

I	NI	NP	D
---	----	----	---

Light and air gaps were present at the exterior doors. This can result in significant energy loss and moisture intrusion. Recommend installation of additional weatherstripping.

Recommendation: Contact a qualified door repair/installation contractor.



Entryway

6: Self-Closing Garage Door

[Handyman/Maintenance Item](#)

The house to garage door does not self-close and latch. A self-closing, house to garage door is recommended for safety and fire protection.

Recommendation: Contact a qualified door repair/installation contractor.



Garage

7: Self-Closing Garage Door - Adjustment

[Handyman/Maintenance Item](#)

Self-closing hinges are installed but require adjustment to close properly.

I	NI	NP	D
---	----	----	---



8: Doors Collide

🔴 Recommendation

The doors collide when opening and closing.

Recommendation: Contact a qualified professional.



Bathroom

9: Door Stops

🔧 Handyman/Maintenance Item

There were loose, damaged and/or missing door stops in the home. Repair or replacement is recommended to limit damage to walls.

Recommendation: Contact a handyman or DIY project

I NI NP D



Laundry Room

H. Windows

Comments:

Window Type: Vinyl - Double pane insulated

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) exhaustively inspect insulated windows for evidence of broken seals;

(B) exhaustively inspect glazing for identifying labels; or

(C) identify specific locations of damage.

The inspector does not inspect or comment on the presence or condition of storm windows, awnings, shutters, or other security devices or systems. Failed thermal seals in insulated windows are not always detectable, depending upon atmospheric conditions or if they are particularly dirty or otherwise obstructed.

Visible signs of voided (lost thermal seal) insulated windows can fluctuate with changes in lighting, temperature and/or humidity. Only obvious seal failure (window fogging) is noted in this report. Windows can be constructed with multiple sashes and/or lites which could increase the number of actual voided glazed panels. Should this be a concern, our client should contact a glass window specialist to determine if any additional windows have broken seals. The inspector does not remove any screens or inspect windows which would require a ladder to inspect

Thermal Pane Windows:

As THERMAL PANE WINDOWS lose their vacuum, moisture may appear, and then disappear, depending on inside and outside temperature, barometric pressure and the relative humidity. Windows are listed as OBSERVED AT THE TIME OF THE INSPECTION ONLY, and NO WARRANTY IS EXPRESSED OR IMPLIED. If voided or damaged thermal panes are noted on the inspection report, we would strongly urge that a qualified glass company or glazier be contacted for a further evaluation and any estimates that might be needed.

Window Access:

Not all windows were accessible for inspection. Some of the windows could not be properly inspected, due to the presence of furniture, stored goods and/or delicate items, which are not moved during an inspection.

When these items are removed, there is a possibility that problems will be discovered that were not visible at the time of the inspection.

1: Caulking - Interior Separation

[Handyman/Maintenance Item](#)

I NI NP D

The interior caulk is missing, cracked, or separated around the windows in the home.

Recommendation: Contact a handyman or DIY project



Master/Primary

I. Stairways (Interior and Exterior)

Comments:

Specific Limitations:

Note: Specific Limitations. The inspector is not required to exhaustively measure every stairway component.

1: Loose Railing

🔴Recommendation

The stairway railing is loose. This is a safety concern. Recommend a qualified professional evaluate and repair.

Recommendation: Contact a qualified professional.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

J. Fireplaces and Chimneys

Comments:

Fireplace Fuel Source: N/A

Cclamp?: N/A

Damper: N/A

Chim Flue: N/A

Firestop?: N/A

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) verify the integrity of the flue;

(B) perform a chimney smoke test; or

(C) determine the adequacy of the draft.

TREC Limitations. The inspector is not required to inspect or comment on chimney structures located more than 8' (feet) above roofline. Freestanding wood burning stoves are beyond the scope of this inspection

K. Porches, Balconies, Decks, and Carports

Comments:

General Photos:



Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) exhaustively measure every porch, balcony, deck, or attached carport components; or

(B) enter any area where headroom is less than 18 inches or the access opening is less than 24 inches wide and 18 inches high.

1: Patio/Porch Cracking - Cosmetic

[Handyman/Maintenance Item](#)

There is cracking noted at the patio/porch surfaces.

I NI NP D

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

Comments:

General Electrical Photos:



Electrical Service Entrance: Underground

Panel Location : Exterior

Panel Brand: Square D

Main Conductor Wiring Type: Copper

Panel Labeled?: Yes

Panel Amps: 200 Amps

Over-Current Protection: Breakers

Sub-panel Location : Garage

Grounding Types: Main Panel, Ufer, Grounding Rod

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

(A) determine present or future sufficiency of service capacity amperage, voltage, or the capacity of the electrical system;

I NI NP D

- (B) test arc-fault circuit interrupter devices when the property is occupied or damage to personal property may result, in the inspector's reasonable judgment;
- (C) conduct voltage drop calculations;
- (D) determine the accuracy of overcurrent device labeling;
- (E) remove covers where hazardous as judged by the inspector;
- (F) verify the effectiveness of overcurrent devices; or
- (G) operate overcurrent devices.

The inspector is not required to determine the insurability of the property. The inspector will inspect the service entrance cables and report any deficiencies in the insulation, drip loop, service line clearances and separation of conductors at weather heads.

Townhome/Condo Grounding:

The inspected address is a townhome or condominium and the main grounding sources are not visible due to limited access to the service entrance. Grounding sources could not be viewed for inspection.

B. Branch Circuits, Connected Devices, and Fixtures

Comments:

Wiring Type: Copper



Smoke Detectors Present: All Bedrooms, Hallways

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

Smoke Detectors Hard Wired: Yes
 Carbon Monoxide Detectors: Yes
 GFCI - Bathrooms: Present and Tripping
 GFCI - Kitchen: Present and Tripping
 GFCI - Exterior: Present and Tripping
 GFCI - Garage: Present and Tripping
 GFCI - Laundry: Not Able To Test - Blocked
 GFCI - Detached Structure: N/A
 GFCI - Bar Area: N/A
 Dryer Outlet Tested: No (Dryer plugged into outlet)
 Additional 240V Outlet Tested: N/A

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

- (A) inspect low voltage wiring;
- (B) disassemble mechanical appliances;
- (C) verify the effectiveness of smoke alarms;
- (D) verify interconnectivity of smoke alarms;
- (E) activate smoke or carbon monoxide alarms that are or may be monitored or require the use of codes;
- (F) verify that smoke alarms are suitable for the hearing-impaired;
- (G) remove the covers of junction, fixture, receptacle or switch boxes unless specifically required by these standards

The inspector will report as in need of repair the lack of ground fault circuit protection where required.
 **Homes built prior to 1974 could have aluminum wiring present in the branch circuits. Inspector observes branch circuit wiring type within the service panel. Hidden wiring that is not present within the panel could not be observed by inspector.

IC Fixtures :

Recessed luminaries/light fixtures can pose a possible fire hazard if they are not I-C rated and specifically designed for installation in an insulated ceiling. Inspector was unable to confirm if lights are insulation compatible (IC) fixtures. Further evaluation is recommended.

1: Missing Smoke Alarms

Recommendation

Living Room

Insufficient number of smoke alarms. Current TREC standards require smoke alarms to be present in all bedrooms, all hallways adjacent to the bedrooms, and living rooms. Some city jurisdictions require smoke alarms to be present in the bedroom and hallways adjacent to. It is recommended the local building codes be checked for proper installation.

- C. Other**

Comments:

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Comments:

Unit Information:

The National Association of Home Builders and Bank of America Home Equity division produced a Study of Life Expectancy of Home Components in February 2007. Life expectancy is based on first owner use.

That study noted that the expected life span (on average) of gas-fired heaters is about 18 years.

That study noted that the expected life span (on average) of electric heaters is about 15-20 years.

Take this into consideration when noting the manufacture date for the unit at this property. It is recommended that units of the above ages be further evaluated and cleaned to verify that the heat exchanger and/or heating elements are working properly.



2022

Furnace Energy Source: Gas

Furnace Type: Forced Air - Gas Fired

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

Furnace Location: Attic

Heating Temperatures:

Location

Kitchen 101

Living Room 103

Dining Room 105

Master Bedroom 130

Bedroom 2 130

Bedroom 3 127

Specific Limitations:

Note: Specific Limitations

The system fan, burner, and heat exchanger are not readily available for inspection without disassembly of the unit. Because we do not disassemble equipment, the condition of the system interior is unknown. If the system does not have a documented history of regular cleaning and maintenance, servicing by a licensed HVAC technician will be required. Recommend annual cleaning and service by licensed HVAC technician.

The inspector will describe the type of heating system and its energy sources and inspect each unit.

*Manufacturer numbers are provided as additional information to the client. Appliances are not researched for recalls. If buyer has further concerns regarding recalls the appliance manufacturer should be contacted.

I NI NP D

Heat Exchanger:

Determining the full integrity of the heat exchanger requires the dismantling of the heat exchanger and is beyond the scope of a visual inspection, as outlined in Title 535.229 (t) of the Standards and Practices.

Due to design, heat exchangers are viewed from the draft hood and / or burner opening only and are not fully inspected. We strongly urge you to have an industry accepted specialist fully inspect and report on the internal condition of the heat exchanger.

1: Excessive Differentials

🔴Recommendation

The temperature differentials indicate a problem with the heating system or system ducting. A difference of 10°F or less (per unit) indicates proper heating. This system should be inspected and repaired by a licensed H.V.A.C. professional.

Recommendation: Contact a qualified HVAC professional.

2: Light Gaps Around Flue

🔴Recommendation

Light gaps were observed around the vent flue at the roof penetration. This can lead to water penetration. Repair is recommended.

Recommendation: Contact a qualified HVAC professional.



B. Cooling Equipment

Comments:

Condensing Unit Information:

The National Association of Home Builders and Bank of America Home Equity division produced a Study of Life Expectancy of Home Components in February 2007. Life expectancy is based on first owner use. That study noted that the expected life span (on average) of air conditioners is about 10-15 years. Take this into consideration when noting the manufacture date listed for the unit at this property. Any service life in excess of 15 years is in the realm of good fortune only and should be viewed as such. The complete system will require a higher level of maintenance, and may be more prone to major

I NI NP D

component breakdown. Predicting the frequency or time frame for repairs on any mechanical equipment is virtually impossible.



2022

Evaporative Coil Unit Information:

The National Association of Home Builders and Bank of America Home Equity division produced a Study of Life Expectancy of Home Components in February 2007. Life expectancy is based on first owner use. That study noted that the expected life span (on average) of air conditioners is about 10-15 years. Take this into consideration when noting the manufacture date listed for the unit at this property. Any service life in excess of 15 years is in the realm of good fortune only and should be viewed as such. The complete system will require a higher level of maintenance, and may be more prone to major component breakdown. Predicting the frequency or time frame for repairs on any mechanical equipment is virtually impossible.



2021

*Outdoor Temp: 90s
Coolant Type: 410A
Cooling Temperatures:*

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

Location	Return	Supply	Differential
Kitchen	70	55	15
Living Room	70	57	13
Dining Room	70	56	14
Master Bedroom	70	56	14
Bedroom 2	69	56	9
Bedroom 3	70	58	12
Playroom	68	53	15

A differential of 15 degrees Fahrenheit or higher is desired for optional efficiency.

Specific Limitations:

Note: Specific Limitations. The system fan and evaporative coil are not readily accessible for inspection without disassembly of the unit. Because we do not disassemble equipment, the condition of the system interior is unknown. If the system does not have a documented history of regular cleaning and maintenance, servicing by a licensed HVAC technician is required. Recommend annual cleaning and service by licensed HVAC technician. The inspector will not pressure test the system coolant or determine the presence of leaks; or operate setback features on thermostats or controls. We do not inspect for efficiency, capacity or adequacy of units, and the secondary drain lines are not traced for termination. Secondary drain lines are not tested for proper drainage. The inspector will describe the type of cooling system and its energy sources and inspect each unit.

The inspector does not determine the Seasonal Energy Efficiency Ratio (SEER) rating of the HVAC system.

I NI NP D

This equipment rating is published in the Air Conditioning and Refrigeration Institute ARI directory. The inspector does not determine if an air conditioning units condensing coils and evaporating coils are "matched" according to the manufacturer's specifications. If any concerns exist about the "matching" of evaporator coils with condensing coils, a qualified HVAC technician should evaluate the complete HVAC system.

Evaporative Coil (s):

The coils of the indoor portion of the HVAC system were not actually observed and are beyond the scope of this visual inspection. The "indoor" coils are enclosed within the actual cabinet which would require specialized tools / equipment to access. The HVAC unit's warranty could be voided if an unqualified non-Licensed HVAC technician were to cut into the plenum, damage sealant, remove support strapping mounted in the evaporator coil's access panel, remove flues and/or remove any of the ductwork. If documentation is unavailable on the maintenance history of the units or if any concerns exist about the condition of the coils, a qualified licensed HVAC technician should evaluate the complete HVAC system.

1: Insufficient Differential

➡ Recommendation

The temperature differentials indicate a problem with the cooling system or system ducting. A differential of 15°F or higher indicates proper cooling. This system should be inspected and repaired by a licensed H.V.A.C. professional.

Recommendation: Contact a qualified HVAC professional.

C. Duct Systems, Chases, and Vents

Comments:


Filter Type: Disposable



I	NI	NP	D
---	----	----	---



I NI NP D

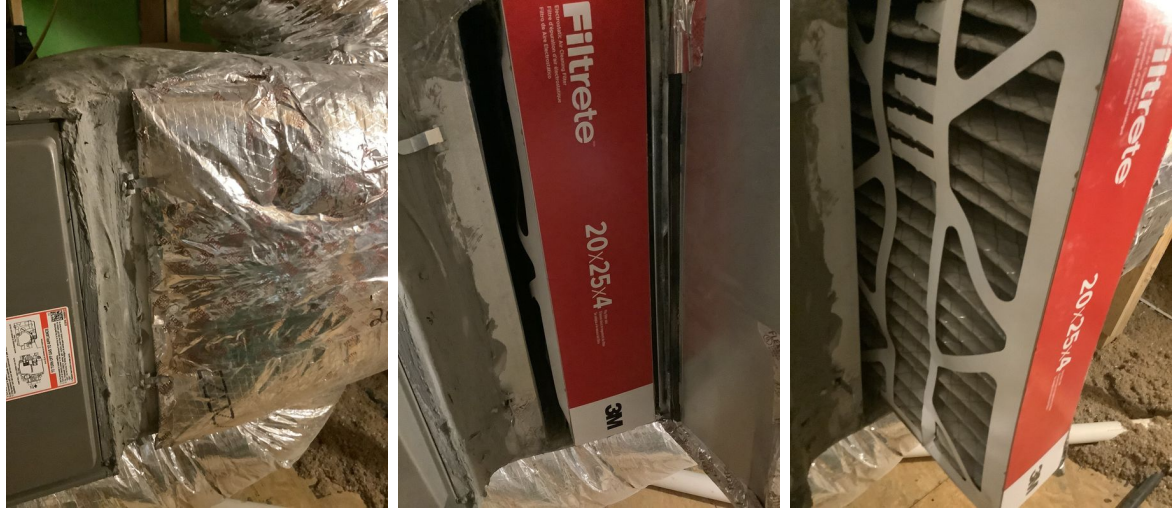

Filter Location: At Unit(s) in Attic

Filter Size: 20X25X4

Duct Location: Attic

Duct Type: Flexible

Specific Limitations:

Note: Specific Limitations. The inspector will not determine the efficiency, adequacy, or capacity of the systems; determine the uniformity of the supply ducts; determine the types of materials contained in insulation, wrapping of pipes and ducts, jackets, boilers, and wiring; operate venting systems unless ambient temperatures, or other circumstances, in the reasonable opinion of the inspector, are conducive to safe operation without damage to the equipment or operate a unit outside its normal operating range. Tip: Seal the plenum, duct hubs and evaporator coil seams with aluminum tape or HVAC ductwork mastic for a possible savings in energy consumption of as much as 35%.

Duct Interior:

The interior of the ducting system is not accessible for observation and inspection. Ducts are tested by air temperature at the rooms and inspected visually.

Not Inspected - Limited Attic Access:


Attic access was limited and ducts were not fully visible for inspection.

1: Dirty Filters

[Handyman/Maintenance Item](#)

At the time of inspection the filters were dirty. Air filters are recommended to be changed monthly for 1" filters and every 3-6 months for 4" filters.

Recommendation: Recommended DIY Project

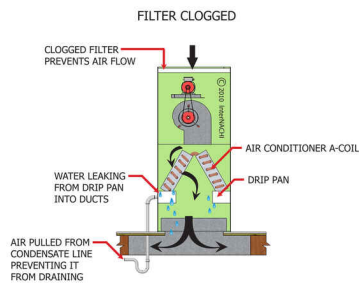

Report Identification:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



-
-
-
-

D. Other

Comments:

I NI NP D

IV. PLUMBING SYSTEMS


A. Plumbing Supply, Distribution Systems and Fixtures

Comments:

General Plumbing Photos:



I NI NP D

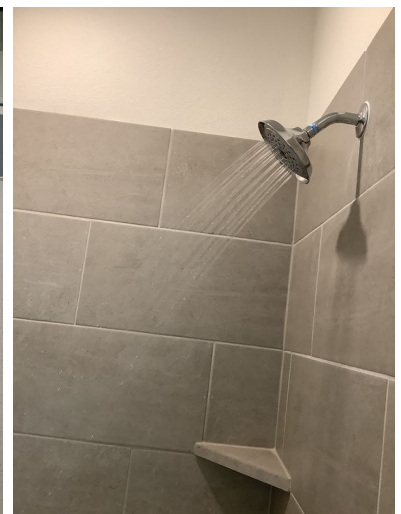

I	NI	NP	D
---	----	----	---



Water Meter Location: Curb

Main Water Shut off Location: Garage Wall

Static Water Pressure Reading: 90



Type of Supply Piping Material Observed: Copper

Water Meter Test - No Movement:

There was NO movement in the water meter dials after a meter test. This indicates no supply line leaks at the time of inspection.

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

- (A) operate any main, branch, or shut-off valves;
- (B) operate or inspect sump pumps or waste ejector pumps;
- (C) verify the performance of:
 - (i) the bathtub overflow;
 - (ii) clothes washing machine drains or hose bibs; or
 - (iii) floor drains;
- (D) inspect:
 - (i) any system that has been winterized, shut down or otherwise secured;

I NI NP D

- (ii) circulating pumps, free-standing appliances, solar water heating systems, water-conditioning equipment, filter systems, water mains, private water supply systems, water wells, pressure tanks, sprinkler systems, swimming pools, or fire sprinkler systems;
- (iii) inaccessible gas supply system components for leaks;
- (iv) for sewer clean-outs; or
- (v) for the presence or performance of private sewage disposal systems; or
- (5) determine:
 - (A) quality, potability, or volume of the water supply; or
 - (B) effectiveness of backflow or anti-siphon devices.

Plumbing - Visible Areas:

Plumbing Areas - Only Visible Plumbing Inspected

Washing Machine Connected to Valves: The occupant's washing machine was installed at time of inspection. This prevented an evaluation of the hose bibbs for possible leakage, proper function of the drain line, possible damage to the wall behind the washing machine or possible damage to the floor.



1: Water Pressure - Low when Hot Water is Used

🔴Recommendation

Bathroom, Master/Primary Bathroom

Low water pressure is noted when hot water is in use.

Recommendation: Contact a qualified plumbing contractor.

2: Surface Staining - Shower

🔴Recommendation

Surface staining was observed at the bathroom shower.

I	NI	NP	D
---	----	----	---



3: Bad Toilet Chain

🔴 Recommendation

The chain does not lift the flapper properly at the bathroom toilet.

Recommendation: Contact a qualified plumbing contractor.



Master/Primary



Half Bathroom

4: High PSI

🔴 Recommendation

At the time of the inspection, the water pressure to the home was above normal pressure of 80 PSI. A pressure adjustment valve should be installed or adjusted if present by a licensed plumber. Normal water pressure range is between 40 and 80 PSI.

Recommendation: Contact a qualified plumbing contractor.

I	NI	NP	D
---	----	----	---





B. Drains, Wastes, and Vents

Comments:

Type of Drain Piping Material Observed: PVC



I NI NP D

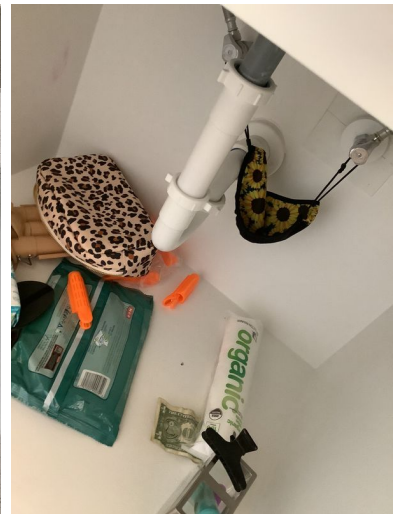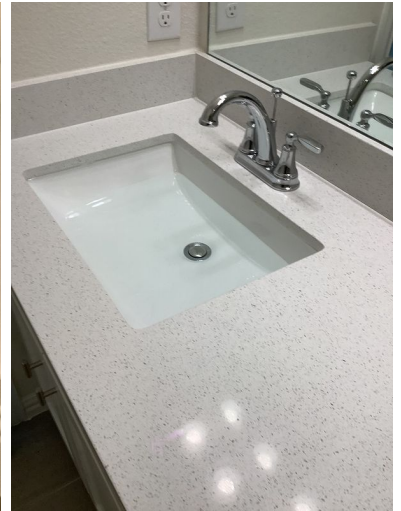

I NI NP D



Type of Drain Piping at Sinks: PVC

AAV Valves:

The drain-waste-vent system (DWV) at the sink employs a mechanical vent, also known as an air-admittance valve or AAV, which is located within the under sink cabinet. Although they may function as intended, AAV's are a mechanical component, and as such, they are subject to failure over time. Failure of these mechanical vents may allow sewer gases to escape into the living space, which would result in potentially hazardous and unhealthy conditions. If, at any time, you notice an odor consistent with waste or sewage, you should immediately contact a qualified plumber to evaluate the AAV.

Overflows:

Tub and sink overflows, and extermination points were not inspected.

1: Gurgling Observed

Recommendation

Bathroom, Master/Primary Bathroom

Gurgling sound was observed. Possible venting issue or clog in the area of concern. Recommend a qualified professional evaluate and repair.

Recommendation: Contact a qualified plumbing contractor.

C. Water Heating Equipment

Comments:

Unit Information:

The National Association of Home Builders and Bank of America Home Equity division produced a Study of Life Expectancy of Home Components in February 2007. Life expectancy is based on first owner use.

That study noted that the expected life span (on average) of gas-fired heaters is about 18 years.

That study noted that the expected life span (on average) of electric heaters is about 15-20 years.

That study noted that the expected life span (on average) of gas-fired tankless water heaters (on average) is about 20-25 years.

Take this into consideration when noting the manufacture date for the unit at this property. It is recommended that units of the above ages be further evaluated and cleaned to verify that the heat exchanger and/or heating elements are working properly.

I	NI	NP	D
---	----	----	---



Energy Source: Gas

WH Size: Tankless

WH Location: Garage

TP Material: CPVC

WH Pan: Yes

Tankless Unit Service Information:

Tankless water heaters should be maintained by a licensed professional at least once a year. But, you may need to get your water heater serviced twice a year if:

1. The area you live in has hard water.
2. Your water heater is set to a high temperature.

A licensed professional should descale your water heater at least once a year.

Specific Limitations:

Note: Specific Limitations. The inspector is not required to:

- (A) verify the effectiveness of the temperature and pressure relief valve, discharge piping, or pan drain pipes;
- (B) operate the temperature and pressure relief valve if the operation of the valve may, in the inspector's reasonable judgment, cause damage to persons or property; or

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

(C) determine the efficiency or adequacy of the unit.

FYI: Recommend draining and flushing unit once per year to reduce deposits/noise, and extend life of unit. Homes left vacant for extended periods of time may have a buildup of hydrogen sulfide gas inside the water tank. This gas causes an unpleasant "rotten eggs" odor. Generally, flushing the unit a few times will alleviate this problem. If problem persists contact a licensed plumber for further evaluation of the water heater. *Manufacturer numbers are provided as additional information to the client. Appliances are not researched for recalls. If buyer has further concerns regarding recalls the appliance manufacturer should be contacted.

Temperature and Pressure Valve:

Valve is not operated due to possibility of causing leaks.

D. Hydro-Massage Therapy Equipment

Comments:

GFCI Present: N/A

Pump Access: N/A

Specific Limitations:

Note: FYI: Environmental testing of whirlpools is beyond the scope of this inspection. Health problems have been noted and directly linked to the bacterial growth in the distribution lines of the equipment.

Recommend that the manufacturer be consulted for further maintenance and cleaning instructions prior to use. For more information visit: www.whirlpoolcouncil.com

E. Gas Distribution Systems and Gas Appliances

Comments:

Location of Gas Meter: Exterior



Type of Gas Distribution Piping Material: Black Iron

Areas of Rusting/Damage - Gas: Yes

Gas Line Pressure Testing:

Pressure testing gas lines or determining the condition of inaccessible or buried gas lines is beyond the scope of the inspection. This service is best provided by a licensed plumber. All gas lines within the structure and/or buried under ground were not inspected for condition and/or possible leakage. Only readily accessible gas line connections at the individual mechanical equipment are inspected for possible gas leakage. A Combustible Gas Leak Detector was used to check possible gas leaks at connections to any gas ranges, gas water heaters and gas central furnaces that might be present at the time of the inspection. If any concerns

I	NI	NP	D
---	----	----	---

exist about possible gas line failure and/or deficiencies, it is recommended that the complete gas system be evaluated by the local controlling gas supplier and/or a licensed plumber. The gas utility company routinely performs gas leak tests as a part of establishing service.

Gas Lines Obstructed/Not Visible:

Gas lines in the home are viewed from visible areas only. Gas lines/connections within the confined areas of the home cannot be seen for inspection.

1: Rusted Gas Lines

➔ Recommendation

There was rusting at the gas lines at the home. Rusted lines can lead to gas leaks.

Recommendation: Contact a qualified plumbing contractor.



I NI NP D

V. APPLIANCES

A. Dishwashers

Comments:

Appliance Information:



DW Back Flow: Present

Evidence of Leaks: No

B. Food Waste Disposers

Comments:

Appliance Information:



C. Range Hood and Exhaust Systems

Comments:

Appliance Information:

I	NI	NP	D
---	----	----	---



RH Vent: Vents to Exterior

1: Missing Filter

👉 Recommendation

The range exhaust vent filter is missing.

I NI NP D



D. Ranges, Cooktops, and Ovens
Comments:
Appliance Information:



I	NI	NP	D
---	----	----	---



Oven Type: Electric
Range Type: Gas
Gas Line Access: Yes



Oven Heating Within 25 Degrees of 350: Yes

I	NI	NP	D
---	----	----	---



1: Orange Flames

Recommendation

There were orangey flames at the cooktop. Adjustment and repair by qualified technician is recommended.

Recommendation: Contact a qualified professional.



E. Microwave Ovens

Comments:

Appliance Information:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Micro Heat: Yes



F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

Exhaust Fans In Bathroom: Yes

Exhaust Fan In Laundry: Yes

Exhaust Fan Term Vent to Exterior: Yes

G. Garage Door Operators

Comments:

Door Operated: Yes - Automatic door controls

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

H. Dryer Exhaust Systems

Comments:

Termination Location: Outside the structure

Dryer Vent Termination:

The dryer vent termination point was not able to be fully observed or verified.

I. Other

Refrigerator:

Refrigerator



VI. OPTIONAL SYSTEMS

A. Landscape Irrigation (Sprinkler) Systems

Comments:

Sprinkler Panel Location: Not Observed

Full Yard Coverage: N/A

Sprinkler Heads Responding: N/A

Rain Sensor: N/A

Specific Limitations:

Note: TREC Limitations. The inspector is not required to inspect:

- (i) for effective coverage of the irrigation system;
- (ii) the automatic function of the controller;
- (iii) the effectiveness of the sensors; such as, rain, moisture, wind, flow or freeze sensors; or
- (iv) sizing and effectiveness of backflow prevention device.

Drip Lines:

Drip lines are covered and are tested visually and audibly. Some drip lines were not able to be confirmed for proper operation.

HOA Sprinkler : Sprinkler heads were observed. Control panel was not observed or located. The sprinklers are shared between owners and not the responsibility of the individual owner. Not inspected.

1: Exposed Lines

🔴 Recommendation

Sprinkler lines were exposed in various areas. These should be covered to prevent damage to the lines.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

MISC.

Misc

Comments:

Pest Control:

The Structural Pest Control Act requires inspection of only those areas which are visible and accessible at the time of inspection. Some areas of the structure are not accessible to inspection, such as the interior of hollow walls, spaces between floors, areas concealed by carpeting, appliances, furniture or cabinets. Infestations may be active in these areas without visible and accessible evidence. If you desire information about areas that were not inspected, a further inspection may be performed at an additional cost. Carpets, furniture, or appliances are not moved during a routine inspection. Only a visual, non-invasive inspection is performed at the time of inspection. In conjunction with the inspection findings within this report, it is recommended that pest control service be utilized at the property for ongoing and/or preventative measures.

Infrared - No Deficiencies:

A thermal scan of the home was taken using a digital infrared camera to look for hidden water penetration, electrical overheating, and missing insulation. Inspector scanned all accessible areas in the home and found no evidence of these conditions at the time of inspection.

Items Beyond the Inspection Scope:

- Refrigerators Are Not Inspected.
- Expansion tanks and recirculating pumps are not inspected.
- Water filtration or softening systems are not inspected.
- Instant hot water dispensers are not inspected.
- Icemakers are not inspected.
- Solar panels and systems are not inspected.
- Ponds, streams, or other water areas are not inspected.

- Whole house fans are not inspected or tested.
- Whole house vacuum systems are not tested or inspected.

Saunas or steam rooms are not inspected.

Any landscape lighting, patio storage buildings, hot tubs, misting systems, security systems, surround sound systems/wiring, internet connections, and satellite systems that could be present are beyond the scope of this home inspection, and were not inspected.

Purpose: This is a one-time inspection of the subject property to identify and disclose visually observable major deficiencies of the inspected systems and items at the time of inspection only. Our comments are meant to educate and to provide our Client(s) with information about the areas in which the building or home may be deficient. Our intent is not to require every item below to be corrected by the seller. The buyer, seller, and their agents should use this report merely as a tool toward negotiation of a purchase and sell agreement.

Homes do not "Pass" or "Fail" an inspection.

This inspection is not to be technically exhaustive nor is it considered to be a guarantee or warranty, expressed or implied, regarding the conditions of the property.

Scope & Exclusions: This is a visual inspection only. We cannot see into, or behind, walls and we will not attempt to report on systems, items, or conditions that are not readily accessible. We do not disassemble anything. We do not inspect for any environmental issues such as RADON GAS, LEAD PAINT, FORMALDEHYDE, UREA, MOLDS, ASBESTOS, FUNGUS, SOIL CONTAMINATION, MICROWAVE RADIATION, or any other types of contaminants or microbiological organisms.

I NI NP D

We do not inspect for building code compliance, building value, appraisal or cost estimates, soil analysis, adequacy of design, underground pipes or drains, capacity, efficiency, size, value, flood plain location, termite, pest or other real property destroying organisms, or habitability. Detached structures are not included in the inspection unless specifically agreed upon by both the inspector and the client. The above list of exclusions is not all inclusive. The Inspection report may comment on the exclusions noted above in a general fashion without incurring responsibility for the exclusions noted above in whole or part.

We do not move furniture, rugs, paintings, or other furniture. There is no responsibility expressed or implied for latent defects, or for defects not reasonably observable at the time of inspection, or for defects that would require the removal of major or permanent coverings for observation. No representation is made as to the future performance of any item. Inspection of water wells, septic systems, security systems, or fire protection equipment (other than smoke detectors) will not be inspected where state /city / county codes, special training, or certification may be additionally required.

We do not hold ourselves to be specialists for any particular item; nor are we engineers. We are a general real estate inspection company.

PLEASE NOTE: GreenWorks does not inspect for MOLD, MILDEW, FUNGUS and / or SPORES as a part of the standard Texas Real Estate Commission Inspection, UNLESS a separate mold inspection has been ordered PRIOR to date of Standard Home Inspection. If conditions of water penetration and / or migration are reported, it is assumed that conditions can and may exist that would support MOLD, MILDEW, FUNGUS and / or SPORES. While the condition of water penetration and / or migration, if visible and accessible, would be reported to the consumer, the condition of MOLD, MILDEW, FUNGUS and / or SPORES would not be tested, or inspected for. Mold inspections are separate inspections, and require a licensed Mold specialist to comment on, and test for, and report on the presence/absence of Mold, Mildew, Fungus, and spores.

1: Cabinet Door Collides

➡ Recommendation

Cabinet door collided with another surface when operated.

Recommendation: Contact a qualified professional.



I NI NP D

FINAL CHECKLIST

Oven/Range Turned Off: Yes
Lights Turned Off: Yes
Exterior Doors Locked: Yes
Thermostat Initial Setting: 73 Degrees Fahrenheit



Thermostat Leaving Setting: 73 Degrees Fahrenheit



Sprinkler System Initial Setting: N/A
Sprinkler System Departure Setting: N/A
Photo of Supra/Lockbox When Leaving: